


## Ventilation Assessment Summary

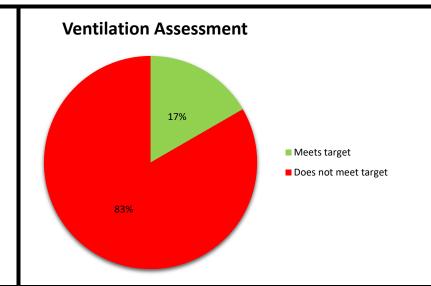

#	HVAC Site		Site	Air Changes			Recommendation	
	Room Type	Campus	Building	Target	Actual	Result	Min. CADR	Min. Supply
1	GM103 Office	Laney College	Gym	3	3.7	Meets target	0	64
2	GM105 Office	Laney College	Gym	3	0.0	Does not meet target	54	59
3	GM107 Office	Laney College	Gym	3	4.2	Meets target	0	59
4	GM109 Office	Laney College	Gym	3	1.5	Does not meet target	25	57
5	GM111 Office	Laney College	Gym	3	0.0	Does not meet target	45	50
6	GM112 Office	Laney College	Gym	3	0.0	Does not meet target	123	136
7	GM110 Office	Laney College	Gym	3	0.0	Does not meet target	46	50
8	GM108 Office	Laney College	Gym	4	0.0	Does not meet target	71	78
9	GM106 Office	Laney College	Gym	3	1.1	Does not meet target	33	59
10	GM104 Office	Laney College	Gym	3	0.0	Does not meet target	54	60
11	GM102 Office	Laney College	Gym	3	0.0	Does not meet target	57	63
12	LKRM104 Gym/Arena	Laney College	Gym	3	18.6	Meets target	0	231
13	100/MENS Locker Room	Laney College	Gym	3	1.0	Does not meet target	3382	5637
14	<u>LR108</u> Locker Room	Laney College	Gym	3	1.1	Does not meet target	301	517
15	<u>LR102</u> Occupiable Storage	([Laney College	Gym	3	0.5	Does not meet target	649	871
16	<u>L112</u> Locker Room	Laney College	Gym	3	0.8	Does not meet target	172	254
17	GM100A Locker Room	Laney College	Gym	3	0.0	Does not meet target	55	61
18	G100 Locker Room	Laney College	Gym	3	0.0	Does not meet target	59	65
19	G101 Locker Room	Laney College	Gym	3	9.4	Meets target	0	1392